



National Transportation Safety Board

Washington, D.C. 20594

Safety Recommendation

LOG-2547

Date: March 9, 1995
In reply refer to: A-95-28

To the operators of air carrier service
under 14 CFR Part 121 and commuter
air carrier service under 14 CFR Part 135
(see attached mailing list)

On September 8, 1994, a USAir Boeing 737-300, flight 427, was on a scheduled passenger flight from Chicago, Illinois, to Pittsburgh, Pennsylvania. During the approach to landing, the airplane suddenly rolled to the left and pitched nose down until it reached a nearly vertical attitude and struck the ground near Aliquippa, Pennsylvania. The airplane was destroyed; the 5 crewmembers and 127 passengers were fatally injured. The Safety Board's investigation of this accident is continuing, and the probable causes have not been determined.

On March 3, 1991, a United Airlines Boeing 737-291, flight 585, was on a scheduled passenger flight from Denver to Colorado Springs, Colorado. As the airplane was completing the turn to final approach, it rolled rapidly to the right and pitched nose down, reaching a nearly vertical attitude before it struck the ground. The airplane was destroyed; the five crewmembers and 20 passengers were fatally injured. In its report on this accident, the National Transportation Safety Board did not reach a determination of the probable cause.¹

Both airplanes were equipped with a flight data recorder (FDR). In each case, however, the FDR did not provide needed information about airplane motion and flight control surface positions during the accident sequence.

¹ National Transportation Safety Board. 1992. United Airlines flight 585, Boeing 737-291, N999UA, Uncontrolled collision with terrain for undetermined reasons 4 miles south of Colorado Springs, Colorado, March 3, 1991. Aircraft Accident Report NTSB/AAR-92/06. Washington, DC.

In the Colorado Springs accident, five parameters--altitude, airspeed, heading, vertical acceleration, and microphone keying--were recorded by the FDR. Currently, regulations contained in Title 14 of the Code of Federal Regulations (14 CFR) Part 121.343 require these five parameters to be recorded by FDRs on airplanes that, like the airplane involved in the Colorado Springs accident, were type certificated prior to October 1, 1969, and were manufactured (received an individual certificate of airworthiness) prior to May 26, 1989.² The FDR of the airplane involved in the Colorado Springs accident did not record (nor was it required to record) other parameters critical to this accident investigation: airplane pitch and roll attitude; engine thrust values; lateral and longitudinal acceleration; control wheel position; rudder pedal position; and control surface positions, such as rudder, aileron, and spoiler.

In the Aliquippa accident, the accident airplane was the same type, a Boeing 737, but the airplane's FDR system had been retrofitted with six additional parameters, in anticipation of the 1995 deadline for these enhancements. However, the additional parameters did not include information on cockpit flight control inputs, flight control surface positions, lateral acceleration, or autopilot status, which has hampered the Board's continuing accident investigation. In a public hearing on the accident, conducted by the Safety Board in Pittsburgh, Pennsylvania, on January 23-27, 1995, witnesses from the FAA, aircraft manufacturers, and airlines agreed that additional FDR parameters would have assisted the Board in determining the probable cause of this accident.

Had the airplanes involved in the Colorado Springs and Aliquippa accidents been equipped with enhanced FDRs, information from the additional parameters would have allowed the Safety Board to quickly identify any abnormal control surface movements, configuration changes, or autopilot status changes that may have been involved in the loss of airplane control. Just as important, information from the additional parameters would have allowed the Board to rule out certain factors, if warranted, and to focus its investigations on other areas.

Information from FDRs with additional parameters substantially aided the Safety Board's investigations of two regional airline accidents that occurred during 1994. The first accident occurred on October 31, 1994, while an American Eagle ATR-72-210, flight 4184, was on a scheduled flight from Indianapolis, Indiana, to

² Part 121.343 requires that by May 26, 1995, large airplanes type certificated prior to October 1, 1969 (which would have included the airplanes involved in the Colorado Springs and Aliquippa accidents) must be equipped with FDRs that record 11 parameters. The additional parameters are longitudinal acceleration, pitch attitude, roll attitude, control column or pitch control surface position, and thrust of each engine (two thrust values for the Boeing 737). Part 121.343 also requires that airplanes type certificated after October 1, 1969 (regardless of the date of manufacture) and airplanes manufactured after May 26, 1989 (regardless of the date of type certification) must be equipped with FDRs that record 17 parameters. Airplanes manufactured after October 11, 1991 (regardless of the date of type certification) must be equipped with FDRs that record 31 parameters.

Chicago, Illinois. The flight had been placed in a holding pattern over Roselawn, Indiana, because of weather delays at O'Hare Airport. The flight was cleared to remain in the holding pattern and to descend from 10,000 to 8,000 feet. The airplane rolled to the right, entered a steep descent, and struck the ground; all 64 passengers and 4 crewmembers were fatally injured. The Safety Board's continuing investigation has not yet determined the probable cause of the accident; however, information from the enhanced FDR enabled the Safety Board to identify, within hours after receiving the recorder in its laboratories, the key events leading to the airplane's departure from controlled flight and the events during its final descent.

The ATR-72 was equipped with an FDR that recorded 98 parameters, including vane angle of attack (VAOA), aileron bellcrank position, flap position, aileron trim position, and autopilot engagement status. The FDR data showed that as the airplane was descending through 9,400 feet, the wing flaps began to retract and the airplane's VAOA increased. As the VAOA reached 5 degrees the autopilot disengaged, and within 1/4 second the ailerons deflected to near maximum travel in the right-wing-down direction. The FDR data also showed that the rolling moment was reversed when the VAOA was reduced to below 5 degrees, and the ailerons deflected in the left-wing-down direction. The right rolling moment recurred as the VAOA again increased to 5 degrees, and the ailerons deflected in the right-wing-down direction. Control of the airplane was not restored in time to prevent impact with the ground.

The data available from the ATR-72 FDR indicated to investigators that the airplane rolled as expected in response to aileron control surface movements, and that the aileron movements were correlated with increases in the airplane's angle of attack. As a result, the Safety Board was able to focus its efforts on possible explanations for the aileron control surface movements and, within days of the accident, the Board issued urgent safety recommendations to minimize the likelihood of similar occurrences in the future. As part of its continuing investigation, the Safety Board is also examining readouts from FDRs with expanded parameters from seven other ATR airplanes that have reportedly encountered flight control anomalies, three of which have shown important similarities to the accident flight.

The second accident involving an FDR with expanded parameters was one in which FDR data quickly moved the focus of the investigation from airplane systems to operations and human performance. On February 1, 1994, an American Eagle Saab 340B, flight 3641, was approaching Baton Rouge, Louisiana, on a scheduled passenger flight from Dallas/Fort Worth, Texas. As the airplane descended through 9,000 feet, both engines failed. The flightcrew executed a forced landing at False River Air Park in New Roads, Louisiana, during which the airplane sustained substantial damage. The flight attendant received minor injuries during the emergency evacuation. The 2 pilots and 23 passengers aboard were not injured.

The FDR installed on the Saab 340B recorded 128 parameters. FDR data showed that as the airplane descended through 9,040 feet, there was a rapid rise of

both propellers' rotational speed well above the maximum allowable revolutions per minute. Because the FDR also was equipped to capture the positions of the engine power levers, the Safety Board was able to determine that at the same time the propeller speed increased, the power levers moved from the flight idle gate position to aft of the ground idle detents. The airplane's approved flight manual prohibits such power lever movements while in flight. This flightcrew action explained the propeller overspeed, which resulted in dual engine failure. With the expanded FDR data, the Safety Board was able to rule out alternative explanations for the propeller overspeed, including propeller systems failures that previously had affected similar propellers installed in another turboprop regional airliner.³

The importance of FDR data is not limited to investigations of catastrophic accidents. FDR data from incidents, which are less serious but occur more often, can provide to investigators and the aviation community critical information to help prevent accidents involving similar circumstances. Following the Colorado Springs and Aliquippa accidents, the Safety Board investigated 12 Boeing 737 incidents involving anomalous rudder activity or uncommanded roll oscillations. The FDRs aboard the incident airplanes, however, were not equipped to record flight control surface positions, flight control inputs, or lateral acceleration. Like 79 percent of all U.S.-registered Boeing 737s, the airplanes involved in the incidents were manufactured prior to May 26, 1989; consequently, they were required by current regulations to record only the five basic FDR parameters. As a result, critical, objective data were not available from the FDRs, and investigators had little more than the flightcrews' subjective recollections of these dynamic events.

In contrast to the investigations of these 12 Boeing 737 incidents, for which important FDR data were not available, investigations of other incidents have been greatly aided by the availability of enhanced recorded information. These incidents involved airplanes equipped with a digital data bus that transmits information from many sensors to the onboard recording devices.

On October 7, 1993, a British Airways Boeing 747-436 experienced a nose-down pitching moment immediately after departure from London Heathrow Airport. The captain avoided ground contact by exerting substantial back pressure on his control column. The incident was investigated by the United Kingdom's Air Accidents Investigation Branch (AAIB). Of the many parameters that were available on the airplane's digital data bus, recorded by a Quick Access Recorder (QAR)⁴ and available to the FDR, several were useful in the AAIB's investigation. These parameters included the position of each of the four elevator control surfaces, control column

³ National Transportation Safety Board. 1992. Atlantic Southeast Airlines, Inc., flight 2311, Uncontrolled collision with terrain, an Embraer EMB-120, N270AS, Brunswick, Georgia, April 5, 1991. Aircraft Accident Report NTSB/AAR/92/03. Washington, DC.

⁴ QARs and FDRs have similar data storage capabilities, but QARs, primarily intended for air carrier maintenance fault analysis, are not hardened to survive crash impact and fire conditions.

position, radar altitude, landing gear position, and hydraulic system pressure. By analyzing the information from the QAR, the AAIB established that "the upset was caused by the uncommanded pitch-down movement of both right-side elevators, coincident with landing gear retraction."⁵ As a result of its investigation, the AAIB recommended that the FAA require modifications of Boeing 747 hydraulic systems and elevator power control units.

Between June and August 1993, Air France Boeing 737-300 airplanes experienced three rudder deflection anomalies. For each incident, about 206 flight data parameters were available to the French accident investigation authority, Bureau Enquetes Accidents (BEA). The data were recorded on QARs, and available parameters included control surface positions, flight path data, acceleration in three axes, yaw damper, and autopilot modes. The Safety Board is evaluating the data from these incidents for possible applicability to the Aliquippa or Colorado Springs accidents.

The data required to be recorded on FDRs have been based on the Safety Board's accident investigation experience and the capacity of the recording devices. Over the course of decades, many accidents investigated by the Board focused on wind shear, takeoff overruns, and instances of controlled flight into terrain; fewer accidents involved the inflight loss of lateral or directional control. In response, FDR parameter requirements focused on airplane performance (such as airspeed, altitude, and longitudinal acceleration) rather than on flight control (such as rudder position and trim settings). However, the recent accidents and incidents, discussed above, have demonstrated that more information about flight control parameters should be recorded by FDRs.

Among the additional flight control parameters that are needed are parameters that pertain to the positions of flight control inputs and flight control surfaces. Under current rules, airplanes fitted with conventional flight controls are permitted to record either the cockpit control input (such as control wheel position) or the control surface (such as the direction and amount of aileron deflection), if one can be derived from the other. But in its investigations of the recent Boeing 737 accidents, the Safety Board found that in some failure modes, flight control surface positions could move independently of cockpit flight control inputs. Also, under some conditions, additional information is needed by investigators to determine whether the controls on the flight deck caused the control surfaces to move, or vice versa. Consequently, FDRs should record both the flight control inputs and flight control surface positions.

⁵ U.K. Department of Transport, Air Accidents Investigation Branch. 1995. Report on the incident to Boeing 747-436, G-BNLY at London Heathrow Airport on 7 October 1993. Aircraft Accident Report 1/95. London, England.

Flight control trim information, including the positions of trim controls for roll and yaw, also has been essential during recent accident investigations. For example, the aileron and rudder trim parameters provided answers to critical questions early in the investigation of the Roselawn accident. The airplane involved had previously experienced trim anomalies; the FDR revealed none on the accident flight.

Recent technological changes have made feasible the acquisition and storage of large amounts of data on FDRs. Today, even for older airplanes, many FDR systems can record additional parameters because of unused capacity in the flight recording system. In terms of flight recording systems, there are two general categories of airplanes in the current air carrier fleet: analog airplanes, and airplanes equipped with a digital data bus.

On an analog airplane, information from remotely located data sensors (for example, a rudder position sensor located in the tail section) is transmitted to the FDR via dedicated wires in an analog format. The information is then converted to digital format in the FDR or the flight data acquisition unit (FDAU).

On an airplane equipped with a digital data bus, information is transmitted in digital format from a multitude of sensors, along a single, high capacity communications pathway (data bus). Information transmitted on the bus is provided to a number of systems, including flight management computers, cockpit displays, QARs, and FDRs. Additional data can readily be fed from the bus to the FDR, based on information that is already on the bus for other purposes or added to the bus by new sensors.

Upgrading FDRs with additional parameters would result in improved aviation safety. The Safety Board acknowledges, however, that retrofitting airplanes that are currently operating in air carrier service would necessitate a significant monetary investment, especially for analog airplanes.

The Safety Board obtained information about the cost of upgrading FDRs on analog airplanes from an air carrier trade group and an FDR equipment manufacturer. In a petition submitted to the FAA, the Air Transport Association (ATA) reported that to upgrade an FDR with six additional parameters would require a one-time expenditure of about \$250,000 per airplane type for engineering specifications and the development of retrofit kits.⁶ These one-time costs would be spread over all of the individual airplanes of each type that are retrofitted; that is, if there are 500 airplanes in service, the cost for basic engineering would be \$500 per airplane. Additional expenditures would be required for labor and equipment to upgrade each individual airplane; an ATA member survey stated that the installed

⁶ Letter of June 5, 1992, to the FAA Office of General Counsel Rules Docket, from Joseph D. Vreeman, Vice President of Engineering, Maintenance, and Materiel, Air Transport Association.

equipment cost for a six-parameter upgrade would total between \$20,000 and \$40,000 per individual airplane.⁷

The Safety Board also obtained estimates of installed equipment cost to upgrade an FDR to record the parameters listed in "Proposed Minimum FDR Parameter Requirements for Airplanes in Service" (attachment A to this letter). The information was provided by an FDAU manufacturer and an FDR manufacturer.

The FDAU manufacturer estimates that retrofitting an analog airplane could cost about \$20,000 to \$30,000. This estimate includes about \$1,000 per additional parameter (\$200 to \$400 of which is for sensors; the remainder is for associated wiring and labor). The FDR manufacturer estimates that to record the parameters listed in attachment A, many airplanes may require the use of an FDAU, which could cost an additional \$15,000 to \$20,000 for each airplane not already so equipped. Based on the various estimates, it appears that retrofitting an analog airplane to record the parameters listed in attachment A could cost between \$25,000 and \$70,000.

Retrofitting an airplane equipped with an ARINC 429 digital data bus or equivalent (such as the Boeing 757 and 767) to record, as a minimum, the parameters listed in attachment A would be less expensive. Most wiring changes would be confined to the electronic equipment compartment, and some reprogramming of the digital FDAU would be required. All of the airplanes would require the addition of flight control surface position sensors. Some airplanes that were manufactured on or before October 11, 1991, may also require additional sensors.

During the public hearing on the Aliquippa accident, a major U.S. air carrier expressed concern about the costs of upgrading FDRs on the carrier's fleet. The Safety Board recognizes that enhanced FDR capability needs to be weighed against the costs. However, the Board also believes that the costs should be balanced against the remaining useful life and revenue-earning potential of an airplane. Using an upper-bound retrofit cost of \$70,000 per airplane and reasonable assumptions about airplane utilization,⁸ the Safety Board estimates the cost of retrofitting an airplane in current service with an enhanced FDR to be less than 7¢ per passenger.

The Safety Board believes that public safety outweighs the 7¢-per-passenger cost of equipping older airplanes to record more FDR parameters, especially if the retrofit program is limited to airplane types that remain in production (including

⁷ Summarized by the FAA in its Notice of Proposed Rulemaking on extension of the compliance date for installation of digital FDRs on Stage 2 airplanes, Federal Register (Vol. 59, No. 36), p. 8573.

⁸ Assumptions are as follows: average seating capacity of 150 passengers, 3 departures per day, a 65-percent passenger load factor, and a useful life of 10 years.

derivative models⁹). According to information provided by the FAA to the Safety Board,¹⁰ the U.S. register currently lists about 2,000 transport category airplanes (such as DC-9s, B-737s, and F-28s) that were type certificated before October 1, 1969. These types are still in production (including derivatives, such as MD-80s, B-737-400s, and F-100s), and most of these airplanes use the analog method of data acquisition and transmission.

The Safety Board believes that transport category airplanes of a type that is still in production and operated under 14 CFR Parts 121, 125, or 135 should be retrofitted with the sensors and FDAU needed to record, as a minimum, the parameters listed in attachment A. Further, these airplanes should continue to record the FDR parameters required by current regulations applicable to each airplane (based on its dates of certification and manufacture). Although Boeing 727 and Lockheed L-1011 airplanes are not currently in production, nearly 800 airplanes of these types are expected to remain in the U.S. airline fleet by the end of the 1990s.¹¹ Accordingly, the Safety Board believes that these airplanes should also be retrofitted to record on FDRs, as a minimum, the parameters listed in attachment A.

To ensure that individual airplanes have a substantial useful life over which to recoup the cost of FDR enhancement, the Safety Board believes that the retrofit should apply only to airplanes (except for Boeing 737s, which are addressed later in this letter) that comply with Stage 3 noise requirements,¹² or that remain in service after December 31, 1999, by receiving a waiver or exemption from Stage 3 noise requirements. This criterion would apply the FDR enhancements only to individual airplanes that have the opportunity to operate well into the next decade.

The Safety Board believes that the FAA should complete its rulemaking on FDR enhancements by December 31, 1995. Further, the FAA should require all operators of transport category airplanes under 14 CFR Parts 121, 125, or 135 to complete the FDR enhancements by January 1, 1998. Airplanes that do not currently comply with Stage 3 noise requirements should be retrofitted with these FDR enhancements by January 1, 1998, or by the later date when they meet Stage 3 noise requirements but, regardless of Stage 3 compliance status, no later than December 31, 1999.

⁹ Derivative models are updated versions of older airplane types that continue to use the original FAA aircraft type certificate. Examples include the McDonnell Douglas MD-80 series, based on the DC-9, and the Fokker F-100, based on the F-28.

¹⁰ Letter of December 14, 1994, from FAA Administrator David R. Hinson to Safety Board Chairman Jim Hall.

¹¹ Derived from information in the letter of December 14, 1994, from FAA Administrator Hinson.

¹² According to 14 CFR 91.853, all airplanes will be required to meet Stage 3 noise requirements by December 31, 1999.

With regard to Boeing 737 airplanes, which account for about 23 percent of the U.S. air carrier fleet, the Safety Board believes that FDR enhancement is needed sooner. Data from enhanced FDRs play a vital role in helping to prevent accidents through information they provide about incidents.¹³ During the public hearing on the Aliquippa accident, the Boeing Commercial Airplane Group indicated that it had records of 187 flight control incidents involving Boeing 737s that occurred between 1970 and 1994. Of the 187 incidents, 35 occurred in 1993 and 1994. Because the Boeing 737 will be used for years to come, it is essential that the airplanes involved in future incidents be equipped with enhanced FDRs. Consequently, the Safety Board believes that the FAA should require that all Boeing 737 airplanes operated under 14 CFR Parts 121 and 125, regardless of Stage 3 compliance status, be equipped, by December 31, 1995, with FDRs that record, as a minimum, the parameters required by current regulations plus the following parameters (recorded at the sampling rates specified in attachment A): lateral acceleration; flight control inputs for pitch, roll, and yaw; and primary flight control surface positions for pitch, roll, and yaw.

According to information provided to the Safety Board by the FAA,¹⁴ as many as 1,000 Boeing 737 airplanes would be affected by the retrofit. The additional parameters could, in most cases, be accommodated by the currently installed FDR and FDAU systems. As a result, the Safety Board estimates that the cost to add these parameters would total between \$10,000 and \$20,000 per airplane.

In the ATR-72 and Saab-340B accidents, the traveling public benefited from earlier corporate decisions by Avions de Transport Regional (ATR), Saab Aircraft AB, and AMR Corporation/American Eagle to equip the airplanes with FDRs that record more parameters than are currently required by the Federal Aviation Regulations. American Eagle also has taken the initiative to retrofit its 19-seat, British Aerospace Jetstream airplanes with enhanced FDRs. In the Safety Board's opinion, the leadership role taken by these companies should be followed by others in the aircraft manufacturing and air carrier industries. Because the Board recognizes that regulatory change is not accomplished as quickly as action taken by individual companies, the Safety Board believes that the operators of transport category airplanes currently in service under 14 CFR Parts 121 and 135 should voluntarily modify FDRs installed on their airplanes to record, as a minimum, the parameters listed in attachment A plus the parameters that are currently required by the regulations applicable to each airplane.

¹³ In addition to the role that enhanced FDR data can play in accident and incident investigations, the data will be of great assistance to air carriers' Flight Operations Quality Assurance (FOQA) programs. FOQA is a proactive, accident prevention program that involves the analysis of data collected during normal flights, for the purpose of enhancing the safety of flight operations. The Safety Board joins the FAA, the Department of Transportation, and many industry representatives in supporting the development of FOQA programs.

¹⁴ Letter of December 14, 1994, from FAA Administrator Hinson.

Most newly manufactured airplanes used in air carrier service are routinely equipped with digital data buses that carry information on hundreds of parameters. Also, the current state of the art in solid-state memory devices has lifted the previous constraints on the number of parameters that FDRs can record. Consequently, the cost of adding FDR parameters usually will be minimal if the parameters are specified before the airplane is built.

The Safety Board's accident investigation experience in recent years indicates that the FDR parameter requirements for newly manufactured airplanes need to be expanded further. The Board believes that the required FDR parameters for newly manufactured airplanes should include those proposed in EUROCAE Document ED-55¹⁵ plus additional parameters such as flight control input and surface positions. Accordingly, the Safety Board believes that the FAA should require that all airplanes operated under 14 CFR Parts 121, 125, or 135 (10 seats or larger) for which an original airworthiness certificate is issued after December 31, 1996, be equipped with FDRs that record the parameters listed in "Proposed FDR Enhancements for Newly Manufactured Airplanes" (attachment B to this letter). Also, the Safety Board believes that because available technology now permits all FDRs to record at least 25 hours of data, all FDRs installed on these newly manufactured airplanes should have this recording capacity after December 31, 1996.

Because aircraft manufacturers can react more quickly than regulatory requirements can be changed, the Safety Board also believes that the manufacturers should establish, for all newly manufactured airplanes that will be operated under 14 CFR Parts 121, 125, or 135 (10 seats or larger), a minimum standard for recording FDR parameters in accordance with attachment B.

Air travelers and the air carrier industry cannot afford additional unresolved accidents. The Safety Board will continue its efforts to identify the probable cause of the accidents at Colorado Springs and Aliquippa, but enhanced FDR data are essential to help prevent future accidents.

Therefore, the National Transportation Safety Board recommends that the operators of air carrier service under 14 CFR Part 121 and commuter air carrier service under 14 CFR Part 135:

Ensure that the flight data recorders installed on transport category airplanes used in air carrier and commuter air carrier service record, as a minimum, the parameters listed in "Proposed Minimum FDR Parameter Requirements for Airplanes in Service" plus other parameters required by current regulations applicable to each airplane. (Class II, Priority Action) (A-95-28)

¹⁵ European Organisation For Civil Aviation Equipment [EUROCAE]. May 1990. Minimum Operational Performance Specification For Flight Data Recorder Systems (ED-55). Paris, France.

Recommendations were also issued to the Federal Aviation Administration and to the manufacturers of airplanes operated under Parts 121, 125, or 135.

The National Transportation Safety Board is an independent Federal agency with the statutory responsibility "...to promote transportation safety by conducting independent accident investigations and by formulating safety improvement recommendations" (Public Law 93-633). The Safety Board is vitally interested in any actions taken as a result of its safety recommendations and would appreciate a response from you regarding action taken or contemplated with respect to the recommendation in this letter. Please refer to Safety Recommendation A-95-28 in your reply.

.....Chairman HALL, Vice Chairman FRANCIS, and Member HAMMERSCHMIDT
concur in this recommendation.

By:


Jim Hall
Chairman

Enclosures

(

1911
1912
1913
1914
1915
1916
1917
1918
1919
1920

(

.....

1921
1922
1923
1924
1925
1926
1927
1928
1929
1930
1931
1932
1933
1934
1935
1936
1937
1938
1939
1940
1941
1942
1943
1944
1945
1946
1947
1948
1949
1950
1951
1952
1953
1954
1955
1956
1957
1958
1959
1960
1961
1962
1963
1964
1965
1966
1967
1968
1969
1970
1971
1972
1973
1974
1975
1976
1977
1978
1979
1980
1981
1982
1983
1984
1985
1986
1987
1988
1989
1990
1991
1992
1993
1994
1995
1996
1997
1998
1999
2000
2001
2002
2003
2004
2005
2006
2007
2008
2009
2010
2011
2012
2013
2014
2015
2016
2017
2018
2019
2020
2021
2022
2023
2024
2025
2026
2027
2028
2029
2030
2031
2032
2033
2034
2035
2036
2037
2038
2039
2040
2041
2042
2043
2044
2045
2046
2047
2048
2049
2050
2051
2052
2053
2054
2055
2056
2057
2058
2059
2060
2061
2062
2063
2064
2065
2066
2067
2068
2069
2070
2071
2072
2073
2074
2075
2076
2077
2078
2079
2080
2081
2082
2083
2084
2085
2086
2087
2088
2089
2090
2091
2092
2093
2094
2095
2096
2097
2098
2099
2100

(

Attachment A

Proposed Minimum FDR Parameter Requirements for Airplanes in Service

Proposed Minimum Parameters:

1. Altitude
2. Airspeed
3. Vertical acceleration
4. Heading
5. Time of each radio transmission to air traffic control
6. Pitch attitude
7. Roll attitude
8. Longitudinal acceleration
9. Pitch trim position*
10. Yaw trim position**
11. Roll trim position**
12. Control column and pitch control surface position**
13. Control wheel and lateral control surface position**
14. Rudder pedal and yaw control surface position**
15. Thrust of each engine
16. Position of each thrust reverser (or equivalent for propeller airplane)*
17. Trailing edge flap or cockpit flap control position*
18. Leading edge flap or cockpit flap control position*
19. Ground spoiler position/speed brake selection**
20. Angle of attack (when information source is available)**
21. Lateral acceleration**

22. Autopilot engagement status**
23. Automatic Flight Control System (AFCS) modes and engagement status**
24. Outside or total air temperature**

(*) Indicates a new or changed parameter relative to the current 11-parameter requirement. (**) Indicates a new or changed parameter relative to the current 17-parameter requirement.

Notes:

1. Data shall be recorded within the range, resolution, accuracy and sampling intervals specified in EUROCAE Document ED-55, Chapter 3 and Annex 1, unless otherwise noted.
2. Each airplane type will need to be assessed to identify any novel or unique design or operational characteristics. It will then be necessary to ensure that sufficient dedicated parameters, appropriate to these characteristics, are recorded in addition to or in place of other parameters.
3. The flight recorder shall use a digital method of recording and storing the data and a method of readily retrieving those data from the storage medium. The data shall be obtained from sources within the aircraft that enable accurate correlation with data displayed to the flight crew, except when the flight deck displays are filtered or manipulated so as to produce values that do not meet the resolution and accuracy requirements for all phases of flight (for example, some EICAS flight control position display data).

National Transportation Safety Board
February 1995

Attachment B

**Proposed FDR Enhancements
for Newly Manufactured Airplanes**

Acceleration Parameters:

Vertical
Lateral
Longitudinal

Airplane Performance/Position Parameters:

Altitude
Airspeed
Air/ground sensor (primary airplane systems reference, nose or main gear)
Brake pressure and pedal position
Drift angle (when an information source is installed)
Ground speed (when an information source is installed)
Wind speed and direction (when an information source is installed)
Outside air temperature or total air temperature
Radio altitude (when an information source is installed)
Latitude and longitude (when an information source is installed)

Airplane Attitude Parameters:

Angle of attack left and right (when an information source is installed)
Pitch
Roll
Magnetic heading
True heading (when an information source is installed,
sampled 1 per 4 seconds)
Yaw or sideslip angle (when an information source is installed)*

Flight Controls Position and Input Parameters:

All control surface positions--primary controls
(pitch, roll, and yaw)
All cockpit flight control input positions and forces
(control wheel, control column, rudder pedal)
(sidestick controllers on fly-by-wire systems)
All trim surface positions--primary controls**
(pitch, roll, and yaw)

All cockpit trim control input positions--primary controls**
 (pitch, roll, and yaw)
 Thrust/power--primary flightcrew reference
 (may require multiple parameters for all phases of flight)
 Throttle/power lever position
 Thrust reverser status (i.e., stow, transit, deployed, reverse pitch.)
 Thrust command (when an information source is installed)
 Thrust target (when an information source is installed)
 Engine bleed valve position (when an information source is installed)

Airplane Configuration Parameters:

Flap position (trailing and leading edge)
 Spoiler position (ground and speed brake)
 Spoiler/speed brake cockpit selection/status (armed--ground spoiler)
 Flap cockpit control selection
 Landing gear position
 Landing gear cockpit control selection
 De-icing or anti-icing system selection
 (when an information source is installed, sampled 1 per 4 seconds)
 Fuel quantity in CG trim tank (when an information source is installed)
 Computed center of gravity (when an information source is installed)
 AC electrical bus status
 DC electrical bus status
 APU bleed valve position
 Hydraulic pressure (all systems)

Navigation Aids:

Localizer deviation
 Glideslope deviation
 DME 1 and 2 distances
 NAV 1 and 2 selected frequency
 GPS position data (when an information source is installed)
 Marker beacon passage

Autopilot Parameters:

Engagement status (all systems)
 AFCS modes and engagement status

Timing:

Radio transmitter keying
 UCT (when an information source is installed)
 Recorder elapsed time (frame counter, 0 to 4095)
 CVR/DFDR synchronization reference
 (when an information source is installed)
 Event marker

Warning Parameters:

GPWS
 Hydraulic pressure low (each system)
 Master warning
 Loss of cabin pressure
 TCAS--TA, RA, and sensitivity (as selected by crew)
 Icing (when an information source is installed)
 Engine warnings each engine--
 Vibration (when an information source is installed)
 Over temp. (when an information source is installed)
 Oil pressure low (when an information source is installed)
 Over speed (when an information source is installed)
 Windshear (when an information source is installed)
 Computer failure
 Stick shaker/pusher (when an information source is installed)

Manual/Automatic Selected Parameters:

Selected barometric setting
 Selected speed
 Selected vertical speed
 Selected heading
 Selected flight path
 Selected decision height
 EFIS display format
 Head-up display (when an information source is installed)
 Para-visual display (when an information source is installed)
 Multi-function/engine/alerts display format

(*) Range, as installed; accuracy, as installed; resolution, 0.3% of full range; sampling, 1 per second. (**) Range, full travel; accuracy, $\pm 3\%$ unless higher accuracy uniquely required; resolution, 0.3% of full range; sampling, 1 per second.

Notes:

1. Data shall be recorded within the range, resolution, accuracy and sampling intervals specified in EUROCAE Document ED-55, Chapter 3 and Annex 1, unless otherwise noted.
2. Each airplane type will need to be assessed to identify any novel or unique design or operational characteristics. It will then be necessary to ensure that sufficient dedicated parameters, appropriate to these characteristics, are recorded in addition to or in place of other parameters.
3. The flight recorder shall use a digital method of recording and storing the data and a method of readily retrieving those data from the storage medium. The data shall be obtained from sources within the aircraft that enable accurate correlation with data displayed to the flightcrew, except when the flight deck displays are filtered or manipulated so as to produce values that do not meet the resolution and accuracy requirements for all phases of flight (for example, some EICAS flight control position display data).

National Transportation Safety Board
February 1995

**Operators of Air Carrier Service
Under 14 CFR Part 121**

Mr. Carl Donaway
Chief Executive Officer
ABX Air, Inc.
145 Hunter Drive
Wilmington, OH 45177

Mr. Maurice P. Morissette
Chief Executive Officer
Aerial Transit Company
P.O. Box 522760
Miami, FL 33152

Ms. Susan E. Hoshaw
Chief Executive Officer
Air Cargo Express, Inc.
6348 Old Airport Road
Fairbanks, AK 99709

Mr. Patrick J. O'Shea
Chief Executive Officer
Air South, Inc.
1800 St. Julian Place
Columbia, SC 29204

Mr. David M. Clark
Chief Executive Officer
Air Transport International
3800 Rodney Parham Road
Little Rock, AR 72212

Mr. Geoffrey T. Crowley
Chief Executive Officer
Air Wisconsin Airlines Corporation
203 Challenger Drive
Appleton, WI 53915-9120

Mr. Ron R. Hansen
Chief Executive Officer
Airmark Aviation, Inc.
5850 T.G. Lee Boulevard, Suite 345
Orlando, FL 32822

Mr. Robert D. Swenson
Chief Executive Officer
Airtran Airways, Inc.
6280 Hazeltine National Drive, Suite 100
Orlando, FL 32822

Mr. John F. Kelly
Chief Executive Officer
Alaska Airlines, Inc.
P.O. Box 68900
Seattle, WA 98168

Mr. Ronald A. Aramini
Chief Executive Officer
Allegheny Airlines, Inc.
Harrisburg International Airport
Building 601
Middletown, PA 17057-0432

Mr. Glenn R. Zander
Chief Executive Officer
Aloha Airlines, Inc.
P.O. Box 30028
Honolulu, HI 96820

Mr. A. Maurice Myers
Chief Executive Officer
America West Airlines, Inc.
4000 East Sky Harbor Boulevard
Phoenix, AZ 85034

Mr. Robert L. Crandall
Chief Executive Officer
American Airlines, Inc.
Dallas-Fort Worth International Airport
P.O. Box 619616
Dallas-Fort Worth Airport, TX 65261-9616

Mr. Conrad A. Kalitta
 Chief Executive Officer
 American International Airways, Inc.
 842 Willow Run Airport
 Ypsilanti, MI 48198

Mr. J. George Mikelsons
 Chief Executive Officer
 American Trans Air, Inc.,
 Indianapolis International Airport
 P.O. Box 51609
 Indianapolis, IN 46251-0609

Mr. David G. Bassett
 Chief Executive Officer
 AmeriJet International, Inc.
 498 S.W. 34th Street
 Fort Lauderdale, FL 33315

Mr. Jon D. Batchelor
 Chief Executive Officer
 Arrow Air, Inc.
 P.O. Box 26062
 Miami, FL 33102-6062

Mr. John Blue
 Chief Executive Officer
 Atlas Air, Inc.
 538 Commons Drive
 Golden, CO 80401

Mr. Richard Pearson
 Chief Executive Officer
 Buffalo Airways, Inc.
 301 E. 51st Street
 Kansas City, MO 64112

Mr. John A. Catsimatidas
 Chief Executive Officer
 Capitol Air Express
 Smyrna Airport, Hangar 693
 P.O. Box 559
 Smyrna, TN 37167

Mr. Danial A. Ratti
 Chief Executive Officer
 Carnival Air Lines, Inc.
 1815 Griffin Road, Suite 205
 Dania, FL 33004-2213

Mr. B. F. Spohrer
 Chief Executive Officer
 Challenge Air Cargo, Inc.
 P.O. Box 523979
 Miami, FL 33152

Mr. Noel G. Rude
 Chief Executive Officer
 Condor Aviation, Inc.
 Tacoma Narrows Airport
 1620 26th Avenue
 Gig Harbor, WA 98335

Mr. Gordon M. Bethune
 Chief Executive Officer
 Continental Airlines, Inc.
 2929 Allen Parkway
 Houston, TX 77019

Mr. Donald J. Breeding
 Chief Executive Officer
 Continental Micronesia, Inc.
 P.O. Box 8778
 Tamuning, Guam 96931

Mr. Ronald W. Allen
 Chief Executive Officer
 Delta Air Lines, Inc.
 Hartsfield Atlanta International Airport
 Atlanta, GA 30320

Mr. Willard H. Scherrer, Jr.
 Chief Executive Officer
 Emery Worldwide Airlines, Inc.
 3350 West Bayshore Road
 Palo Alto, CA 94303-0986

Mr. Larry K. Lane
 Chief Executive Officer
 Evergreen International Airlines, Inc.
 3850 Three Mile Lane
 McMinnville, OR 97128-9409

Mr. Thomas R. Del-Valle
 Chief Executive Officer
 Executive Airlines, Inc.
 P.O. Box 38082, Airport Station
 San Juan, Puerto Rico 00937-0082

Alinda Wikert
 Chief Executive Officer
 Express One International, Inc.
 3890 W. Northwest Highway
 Suite 700
 Dallas, TX 75220

Mr. Frederick W. Smith
 Chief Executive Officer
 Federal Express Corporation
 2005 Corporate Avenue
 Third Floor
 Memphis, TN 38132

Mr. Barry Fine
 Chief Executive Officer
 Fine Airlines, Inc.
 P.O. Box 523726
 1640 N.W. 62nd Avenue, Bldg. 2169
 Miami, FL 33152

Mr. Theodore L. Vallas
 Chief Executive Officer
 Flight Trails
 246 Fifth Street
 Encinitas, CA 92024

Mr. Haberly Richard
 Chief Executive Officer
 Florida West Airlines, Inc.
 P.O. Box 522207
 Miami, FL 33152

Mr. Samuel Addams
 Chief Executive Officer
 Frontier Airlines, Inc.
 12015 E. 46th Avenue
 Denver, CO 80239

Mr. Shahid Siddiqi
 Chief Executive Officer
 Grand Airways, Inc.
 6005 Las Vegas Boulevard South
 Las Vegas, NV 89119

Mr. Lee Mason Fedrick
 Chief Executive Officer
 Gulf and Caribbean Cargo, Inc.
 3415 S.W. 9th Avenue
 Fort Lauderdale, FL 33315

Ms. Cheryl L. Grue
 Chief Executive Officer
 H C L Aviation, Inc.
 1000 Davidson, Suite 201
 Savannah, GA 31408

Mr. Bruce Nobles
 Chief Executive Officer
 Hawaiian Airlines, Inc.
 P.O. Box 30008
 Honolulu, HI 96820

Mr. M. Tom Christopher
 Chief Executive Officer
 Kitty Hawk AirCargo, Inc.
 P.O. Box 612787
 1515 West 20th Street
 Dallas-Fort Worth Airport, TX 75261

Mr. Danny Wright
 Chief Executive Officer
 Kiwi International Air Lines, Inc.
 Hemisphere Building
 Routes 1 and 9 South
 Newark, NJ 07114

Mr. Mike Nekoba
 Chief Executive Officer
 Mahalo Air, Inc.
 90 Nakolo Place, Suite 215
 Honolulu, HI 96819-1850

Mr. Michael A. Bergt
 Chief Executive Officer
 Markair, Inc.
 P.O. Box 196769
 Anchorage, AK 99519-6769

Mr. Douglas R. Fischer
 Chief Executive Officer
 Miami Air International, Inc.
 P.O. Box 660880
 5000 N.W. 36th Street, Suite 310
 Miami, FL 33159

Mr. Brian J. Olds
 Chief Executive Officer
 Midway Airlines Corporation
 5713 South Central Avenue
 Chicago, IL 60638

Mr. Timothy Hoeksema
 Chief Executive Officer
 Midwest Express Airlines, Inc.
 4915 S. Howell Avenue, 5th Floor
 Milwaukee, WI 53207

Mr. Ernesto Millon
 Chief Executive Officer
 Millon Air, Inc.
 P.O. Box 524057
 Miami, FL 33152

Mr. David Neeleman
 Chief Executive Officer
 Morris Air Corporation
 5200 S. Highland Drive, Suite 300
 Salt Lake City, UT 84117

Mr. Dan McKinnon
 Chief Executive Officer
 North American Airlines
 JFK International Airport
 Building 75, Suite 250
 Jamaica, NY 11430

Ms. Rita N. Sholton
 Chief Executive Officer
 Northern Air Cargo, Inc.
 3900 W. International Airport Road
 Anchorage, AK 99502

Mr. John H. Dasburg
 Chief Executive Officer
 Northwest Airlines, Inc.
 Department A-1020
 5101 Northwest Drive
 Saint Paul, MN 55111-3034

Mr. Sanford P. Burnstein
 Chief Executive Officer
 Omni Air Express, Inc.
 P.O. Box 582527
 Tulsa, OK 74158

Mr. Elijah Jackson
 Chief Executive Officer
 Paradise Airways, Inc.
 Smyrna Airport, Building 693
 Smyrna, TN 37167

Mr. John W. Presburg
 Chief Executive Officer
 Paradise Island Airlines, Inc.
 1550 S.W. 43rd Street
 Fort Lauderdale, FL 33315

Mr. Andrew Barnes
 Chief Executive Officer
 Patriot Airlines, Inc.
 2001 Gateway Place
 Suite 700 West
 San Jose, CA 95110

Mr. John F. Leonard
 Chief Executive Officer
 Piedmont Airlines, Inc.
 5443 Airport Terminal Road
 Salisbury, MD 21801

Mr. Edwin Wallace
 Chief Executive Officer
 Polar Air Cargo, Inc.
 100 Oceangate, 15th Floor
 Long Beach, CA 90832

Mr. Miguel Ordonez
 Chief Executive Officer
 Private Jet Expeditions, Inc.
 The Chattahoochee Bank Building, Suite
 300
 3520 Piedmont Road, N.E.
 Atlanta, GA 30305

Mr. Richard D. Reeve
 Chief Executive Officer
 Reeve Aleutian Airways, Inc.
 4700 W. International Airport Road
 Anchorage, AK 99502-1091

Mr. Lee M. Hydeman
 Chief Executive Officer
 Reno Air, Inc.
 P.O. Box 30059
 Reno, NV 89520-3059

Mr. Lawrence G. Sullivan
 Chief Executive Officer
 Renown Aviation, Inc.
 3940 Mitchell Road
 Santa Maria, CA 93455

Mr. William D. Meenan
 Chief Executive Officer
 Rich International Airways, Inc.
 P.O. Box 522067
 Miami, FL 33152

Mr. Jeffrey C. Crippen
 Chief Executive Officer
 Ryan International Airlines, Inc.
 6810 W. Kellogg
 Wichita, KS 67209-2218

Mr. Terry Hallcom
 Chief Executive Officer
 Shuttle, Inc.
 P.O. Box 710616
 LaGuardia Airport
 Flushing, NY 11371

Mr. Garfield M. Thorsrud
 Chief Executive Officer
 Sierra Pacific Airlines, Inc.
 7700 N. Business Park Drive
 Tucson, AZ 85743-9622

Mr. Peter A. Piper
 Chief Executive Officer
 Simmons Airlines, Inc.
 P.O. Box 612527
 1700 W. 20th Street
 Dallas-Fort Worth Airport, TX 75261-2527

Mr. James Bastian
 Chief Executive Officer
 Southern Air Transport, Inc.
 P.O. Box 524093
 Miami, FL 33152

Mr. Herbert D. Kelleher
 Chief Executive Officer
 Southwest Airlines Company
 P.O. Box 36611
 Dallas Love Field Airport
 Dallas, TX 75235-1611

Mr. Edward W. Homfeld
 Chief Executive Officer
 Spirit Airlines, Inc.
 18121 E. Eight Mile Road, Suite 100
 Eastpointe, MI 48021

Mr. Robert P. Fleming
 Chief Executive Officer
 Sportsflight Airways, Inc.
 2285 E. Elvira Road
 Tucson, AZ 85706

Mr. John J. Skiba
 Chief Executive Officer
 Sun Country Airlines, Inc.
 2520 Pilot Knob Road
 Mendota Heights, MN 55120

Mr. P. Thomas Kolfenbach
 Chief Executive Officer
 Sun Jet International Airlines, Inc.
 11701 Belcher Road, Suite 130
 Largo, FL 33624

Mr. Robert Stephen
 Chief Executive Officer
 Target Airways, Ltd.
 P.O. Box 10165
 Reno, NV 89510

Mr. Bud C. Phillips
 Chief Executive Officer
 TEM Enterprises, Inc.
 976 Mountain City Highway
 Elko, NV 89801

Mr. Morris Nachtomi
 Chief Executive Officer
 Tower Air, Inc.
 Hangar 17
 JFK International Airport
 Jamaica, NY 11430

Mr. Gary J. Balnicki
 Chief Executive Officer
 Trans Air Link Corporation
 P.O. Box 521298
 Miami, FL 33152

Mr. Scott D. Kalitta
 Chief Executive Officer
 Trans Continental Airlines, Inc.
 803 Willow Run Airport
 Ypsilanti, MI 48198

Mr. Robert D. Willman
 Chief Executive Officer
 Trans Florida Airlines, Inc.
 P.O. Box 10150
 Daytona Beach Regional Airport
 Daytona Beach, FL 32120-0150

Mr. J. Erickson
 Chief Executive Officer
 Trans World Airlines, Inc.
 Kansas City International Airport
 P.O. Box 20126
 Kansas City, MO 64195

Hulas Kanodia
 Chief Executive Officer
 UFS, Inc.
 9275 Genaire Drive
 St. Louis, MO 63134

Mr. Gerald Greenwald
 Chief Executive Officer
 United Air Lines, Inc.
 P.O. Box 66919
 Chicago, IL 60666

Mr. Thomas H. Weidemeyer
 Chief Executive Officer
 United Parcel Service Company
 1400 N. Hurstbourne Parkway
 Louisville, KY 40223

Mr. David B. Hermelin
 Chief Executive Officer
 USA Jet Airlines, Inc.
 48100 Tyler Road
 Belleville, MI 48111

Mr. Rocco P. Masiello
 Chief Executive Officer
 USAfrica Airways, Inc.
 11180 Sunrise Valley Drive, Suite 400
 Reston, VA 22071

Mr. Seth E. Schofield
 Chief Executive Officer
 USAir, Inc.
 Crystal Park Four
 2345 Crystal Drive
 Arlington, VA 22227

Mr. Lewis H. Jordan
 Chief Executive Officer
 ValuJet Airlines, Inc.
 1800 Phoenix Parkway, Suite 126
 Atlanta, GA 30349

Mr. Robert McAadoo
 Chief Executive Officer
 Vanguard Airlines, Inc.
 30 N.W. Rome Circle, Mezzanine Level
 Kansas City International Airport
 Kansas City, MO 64153

Mr. Donald D. Rhoads
 Chief Executive Officer
 Viking International Airlines, Inc.
 175 East Reno Avenue, Suite C-9
 Las Vegas, NV 89119

Mr. George Travis
 Chief Executive Officer
 Viscount Air Service, Inc.
 1000 E. Valencia Road
 Tucson, AZ 85706

Mr. Terence O. Dennison
 Chief Executive Officer
 Westates Airlines, Inc.
 Niagara Falls International Airport
 P.O. Box 223
 Wheatfield, NY 14304-0223

Mr. Charles W. Pollard
 Chief Executive Officer
 World Airways, Inc.
 13873 Park Center Road
 Suite 410
 Herndon, VA 22071

Mr. J. Pareti Harold
 Chief Executive Officer
 Worldwide Airline Services, Inc.
 Smith Reynolds Airport
 Terminal Building, Suite 212
 Winston-Salem, NC 27105

Mr. Stuart Hettleman
 Chief Executive Officer
 Wrangler Aviation, Inc.
 P.O. Box 35329
 Greensboro, NC 27425

Mr. Duane A. Zantop
 Chief Executive Officer
 Zantop International Airlines, Inc.
 840 Willow Run Airport
 Ypsilanti, MI 48198-0840

**Operators of Commuter Air Carrier Service
Under 14 CFR Part 135**

Mr. Ervin K. Terry
General Manager
Arctic Circle Air Service, Inc.
P.O. Box 60049
Fairbanks, AK 99706

Mr. Michael A. Spisak
President
Alaska Island Air, Inc.
P.O. Box 1167
Kotzebue, AK 99752

Mr. Archille R. Paquette
President
Air Midwest, Inc.
P.O. Box 7724
Wichita, KS 67277

Ms. Marjorie Baker
President
Baker Aviation, Inc.
P.O. Box 708
Kotzebue, AK 99752

Mr. Larry Kiffley
President
Bemidji Aviation Services, Inc.
P.O. Box 624
Bemidji, MN 56601

Mr. I. Edward London
President
Chautauqua Airlines, Inc.
2500 South High School Road
Box 160
Indianapolis, IN 46241

Mr. Grant B. Thompson
President
Cape Smythe Air Service, Inc.
P.O. Box 549
Barrow, AK 99723

Courtney Anderson
President
Chicago Express Airlines, Inc.
Chicago Midway Airport
5700 South Cicero Avenue
Chicago, IL 60638

Mr. Charles W. Johnson
Chief Operating Officer and President
ERA Aviation, Inc.
6160 South Airpark Drive
Anchorage, AK 99502

Mr. John Hajdukovich
President
Frontier Flying Service, Inc.
3820 University Ave.
Fairbanks, AK 99709

Mr. Lawrence A. Chenaille
President
Larry's Flying Service, Inc.
P.O. Box 2348
Fairbanks, AK 99707

Mr. James D. Rowe
Director of Operations
Bering Air, Inc.
P.O. Box 1650
Nome, AK 99762

Mr. Douglas G. Voss
 Chief Executive Officer
 Great Lakes Aviation, Ltd.
 190 Norwest Financial Center
 Bloomington, MN 55431

Mr. Richard H. Fontaine
 President
 GP Express Airlines, Inc.
 P.O. Box 218
 Grand Island, NE 68802

Mr. Michael A. Bergt
 President, Chief Executive Officer
 Markair Express, Inc.
 P.O. Box 196709
 Anchorage, AK 99519

Mr. Phillip Hendrickson
 President
 Village Aviation, Inc.
 P.O. Box 787
 Bethel, AK 99559

Mr. Von Elbe Antony
 Board of Directors
 Champlain Enterprises, Inc.
 518 Rugar Street
 Plattsburgh, NY 12901

Mr. Mark Leininger
 Chief Operating Officer
 Phoenix Leasing Corporation
 600 Fifth Avenue, 8th Floor
 New York, NY 10020

Mr. Charles J. Colgan
 President
 Colgan Air, Inc.
 10677 Aviation Lane
 Manassas Regional Airport
 Manassas, VA 22110

Mr. Michael G. Robinson
 General Manager
 Trans World Express, Inc.
 Northeast Philadelphia Airport
 Grant Avenue & Ashton Road
 Philadelphia, PA 19114

Mr. Kevin Hack
 General Manager
 Promech, Inc.
 1515 Tongass Avenue
 Ketchikan, AK 99901

Mr. Orin D. Seybert
 President
 Peninsula Airways, Inc.
 6231 Collins Way
 Anchorage, AK 99502

Hulas Kanodia
 President
 Trans States Airlines, Inc.
 9275 Genaire Drive
 St. Louis, MO 63134

Mr. Richard J. Nelson
 Chief Executive Officer
 Astral Aviation, Inc.
 4792 S. Howell Ave.
 Milwaukee, WI 53207

Mr. Floyd Saltz, Jr.
 President
 F S Air Service, Inc.
 6121 South Airpark Place
 Anchorage, AK 99502

Mr. Richard E. Pfennig
 President
 Jetstream International Airlines, Inc.
 3401 Park Center Drive, Suite 290
 Dayton, OH 45414

Mr. Kerry Skeen
 President
 Atlantic Coast Airlines
 1 Export Drive
 Sterling, VA 20164

Mr. Floyd W. Miller
 President
 ACT International Airlines
 1333 Corporate Drive, #210
 Irving, TX 75038

Mr. James W. Petty
 President
 AVI, Inc.
 P.O. Box 11008
 Las Vegas, NV 89111

Mr. George F. Pickett
 Chairman of the Board
 Atlantic Southeast Airlines, Inc.
 100 Hartsfield Centre, Suite 800
 Atlanta, GA 30354

Mr. Clifford N. Langness
 President
 Scenic Airlines, Inc.
 P.O. Box 1385
 Page, AZ 86040

Joaquin L. Flores
 General Manager
 Aviation Services, Ltd.
 P.O. Box 1578
 Guam International Airport
 Agana, Guam 96910

Mr. Jonathan Ornstein
 President
 Continental Express, Inc.
 Gateway II, Suite 600
 15333 John F. Kennedy Boulevard
 Houston, TX 77032

Mr. Melvin E. Spelde
 President and General Manager
 Empire Airlines, Inc.
 2115 Government Way
 Coeur D'Alene, ID 83814

President and Chief Executive Officer
 ComAir, Inc.
 Cincinnati/Northern Kentucky
 International Airport
 Cincinnati, OH 45275

Mr. Robert Calvert
 Director of Operations
 Dolphin Express Airlines, Inc.
 4606 Clyde Morris Boulevard
 Suite 2A
 Daytona Beach, FL 32119

Mr. R. Gauss Eugene
 Chief Executive Officer
 Direct Air, Inc.
 5945 S. Keating
 Chicago, IL 60629

Mr. Philip H. Trenary
 President and Chief Executive Officer
 Exec Express II, Inc.
 131 East Exchange Ave., Suite 222
 Fort Worth, TX 76106

Mr. Charles M. Wilklow
 Chief Executive Officer
 Airways International, Inc.
 Miami International Airport
 P.O. Box 1244
 Miami Springs, FL 33266

Noemi Gonzalez
 President
 Flamenco Airways, Inc.
 P.O. Box 224
 Culebra, Puerto Rico 00775

Mr. William Jones
 General Manager
 Flying Boat, Inc.
 750 S.W. 34th Street
 Fort Lauderdale, FL 33335

Mr. Thomas L. Cooper
 President
 Gulfstream International Airlines, Inc.
 P.O. Box 777
 Miami Springs, FL 33266

Mr. Randy Shirley
 President
 Springdale Air Service, Inc.
 P.O. Box 811
 Springdale, TX 72764

Mr. Lawrence C. Cabrinha
 President
 Aloha IslandAir, Inc.
 99 Kapalulu Place
 Honolulu, HI 96819

Mr. S. Timothy Clarey
 President
 Air LA, Inc.
 5933 West Century Boulevard
 Suite 500
 Los Angeles, CA 90045

Mr. Robert D. Swenson
 President
 Mesaba Aviation, Inc.
 7501 26th Avenue South
 Minneapolis, MN 55450

Mr. Larry L. Risley
 President
 Mesa Airlines, Inc.
 2325 E. 30th Street
 Farmington, NM 87401

Mr. J. Hayes
 President
 Flagship Airlines, Inc.
 2 International Plaza Drive
 P.O. Box 17228
 Nashville, TN 37217

Mr. Robert Christian
 President
 Pacific Island Aviation, Inc.
 Pacific Postal Plus 318
 Box 1000
 Saipan, Northern Mariana Island 96950

Mr. Bryan Bedford
 Chief Executive Officer
 Business Express, Inc.
 Pease International Tradeport
 14 Aviation Avenue
 Portsmouth, NH 03801

Ms. Kathleen Iskra
 President and Chief Executive Officer
 Horizon Air Industries, Inc.
 P.O. Box 48309
 Seattle, WA 98148

Mr. Michael J. Brady
 President
 Express Airlines I, Inc.
 P.O. Box 30397
 Memphis International Airport
 Memphis, TN 38130

Mr. Lewis A. Pierce
 President
 Ross Aviation, Inc.
 P.O. Box 9124
 Albuquerque, NM 87119

Mr. Allen Adili
 President
 Air Sunshine, Inc.
 P.O. Box 22237
 Fort Lauderdale, FL 33335

Mr. Kenneth W. Gann
 President
 CCAir, Inc.
 4700 Yorkmont Road
 Charlotte, NC 28208

Mr. James A. Porter
 Manager
 Samoa Aviation, Inc.
 P.O. Box 280
 Pago Pago, American Samoa 96799

Mr. Victor Rivas
 President
 Conquest Airlines Corporation
 2215 E. M. Franklin Avenue
 Austin, TX 78723

Mr. Jerry Atkin
 President
 Skywest Airlines, Inc.
 444 South River Road
 St. George, UT 84770

Mr. Eugene R. Mallette
 Chief Executive Officer
 Alpine Aviation, Inc.
 P.O. Box 691
 Provo, UT 84603

Mr. Dale Kariya
 Vice President of Operations
 Capitol Air, Inc.
 644 Bayfield
 St. Paul Downtown Airport
 St. Paul, MN 55107

Mr. Alan Berenstein
 President
 Alpha Aviation, Inc.
 9841 Airport Boulevard
 Suite 512
 Los Angeles, CA 90045

Mr. Flemming K. Anderson
 General Manager
 Walkers Aviation Services, Inc.
 700 S.W. 34th Street
 Fort Lauderdale, FL 33335

Mr. Larry Risley
 Chairman of the Board and
 Chief Executive Officer
 WestAir Commuter Airlines, Inc.
 5588 Air Terminal Drive
 Fresno, CA 93727

Ms. Barbara Fesser
 President
 Wings West Airlines, Inc.
 1 Aerovista Place, Suite B
 San Luis Obispo, CA 93401

Mr. James C. Swartz
 President
 Arizona Airways, Inc.
 P.O. Box 64297
 Tucson, AZ 85728