

Lloyds Register Interim Cert. of Class re: Nieuw Amsterdam

**INTERIM CERTIFICATE
PROVISIONAL ISSUE**

Ship's Name: NIEUW AMSTERDAM
LR/IMO Number: 8024014

Port of Survey: Vancouver and at Sea.

Date of Build: 05/1983
Port of Registry: Rotterdam
Gross Tons: 33930

Certificate Number: VCR 000155
First Visit: 18/05/00
Last Visit: 28/05/00

I have carried out the surveys detailed below. All recommendations made by me have been dealt with to my satisfaction. I am recommending to the Committee of Lloyd's Register of Shipping that class be maintained with new records as follows.

	SURVEYS HELD	STATUS	NEW RECORD
	MACHINERY		
CSM	Continuous - Machinery	PART HELD	Date on Completion
ABS2	Auxiliary Boiler s (o.f.)	PART HELD	05/00 on Completion
	HULL		
CSH	Continuous - Hull	PART HELD	Date on Completion
UWE	Underwater Examination	COMPLETE	
AS	Annual	PART HELD	27/05/00 on Completion
HDAM	Hull Damage	COMPLETE	

CONDITIONS OF CLASS NOW IMPOSED


Fire Detection System section 15 covering fire damaged area in "D" Deck between frames 91 and 127.5. to be repaired and tested by the attending Surveyor. Meantime a 24 hour Fire Patrol to be in operation monitoring the necessary area.

**DUE
06/00**

(contd ... 2)

The above recommendation is made subject to any outstanding conditions of class being dealt with as previously recommended.

Signed:
N.HASTINGS

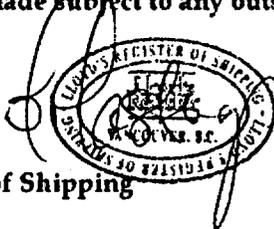

Surveyor(s) to Lloyd's Register of Shipping

Date: 28/05/2000

INTERIM CERTIFICATE PROVISIONAL ISSUE

Ship's Name: NIEUW AMSTERDAM
LR/IMO Number: 8024014

Certificate Number: VCR 000155

CONDITIONS OF CLASS NOW IMPOSED (contd.)

Crack approx 250mm long in superstructure, outboard of Cabin 88 on Navigation Deck Port side Frame 81 to be repaired to the satisfaction of the attending Surveyor.

DUE
08/00

Water Tight Doors No 15, 16 and 23 electrical/hydraulic pumping arrangement to repair and bridge/remote indication for WTD No 15,16,21,22 and 23 to restore. To be specially examined by attending Surveyor.

06/00

Fire Damage in Crew Accommodation on "D" Deck between frames 91 and 127.5. Fire insulation in ceilings and bulkheads, draft stops, electrical cabling, services and lighting fittings to be renewed and repair to SOLAS and Class requirements. Area to be specially examined by the attending surveyor.

06/00

CONDITIONS OF CLASS REVISED

39

NO. 2 STARBOARD F.W. TANK PORT AND STARBOARD LONGITUDINAL AND THE AFT TRANSVERSE BULKHEAD (STARBOARD) AFT SET OUT, FRAMES, BRACKETS IN WAY AND (PORTSIDE) AFT TRANSVERSE UNDERDECK BEAM DISTORTED (NOW TEMPORARILY REPAIRED) TO BE SPECIALLY EXAMINED AND DEALT WITH AS FOUND NECESSARY.

DUE
09/00

(contd ... 3)

**INTERIM CERTIFICATE
PROVISIONAL ISSUE**

Ship's Name: NIEUW AMSTERDAM
LR/IMO Number: 8024014

Certificate Number: VCR 000155

	SURVEYS HELD	STATUS	NEW RECORD
	STATUTORY SURVEYS NOW HELD		
PLI	Load Line Inspection	PART HELD	27/05/00 on Completion
PASS	Passenger Ship Safety	PART HELD	27/05/00 on Completion
PASM	Lifeboat Tender Certificates	COMPLETE	27/05/00
PASM	USCG Port Order	COMPLETE	

MACHINERY DETAILS

ITEMS CREDITED FOR 'CSM'

PORT MAIN INLINE CROSSHEAD ENGINE

0055 NO.4 CYL. COVER, PISTON, ROD, VALVES AND GEARS

1984 STBD MAIN ENGINE BLOWER AIR FORWARD COOLER

ITEMS CREDITED FOR 'ABS2'

BOILER (OTHER THAN MAIN W.T.)

3685 INT. EXAM. INCL. FIT OF DOORS

3692 EXT. EXAM. INCL. FIRE SIDE AND SECURING ARRANGEMENTS

3704 STEAM STOP VALVES

3711 SAFETY VALVES AND MOUNTINGS, EXCEPT STEAM STOP VALVES

HULL DETAILS

ITEMS CREDITED FOR 'CSH'

4026 NO.6 DECK FORWARD SUPERSTRUCTURES

4033 NO.6 DECK MIDSHIP FWD SUPERSTRUCTURES

4040 NO.6 DECK MIDSHIP AFT SUPERSTRUCTURES

4057 NO.6 DECK AFT SUPERSTRUCTURES

(contd ... 4)

**INTERIM CERTIFICATE
PROVISIONAL ISSUE**

Ship's Name: NIEUW AMSTERDAM
LR/IMO Number: 8024014

Certificate Number: VCR 000155

HULL DETAILS

(contd.)

ITEMS CREDITED FOR 'CSH' (contd.)

4064	NO.6 DECK FORWARD HOUSE/S
4071	NO.6 UPPER DECK PLATING
4088	NO.5 AFT DECK PLATING
4095	NO.5 DECK BOW STORE SPACE
4107	NO.4 DECK BOW STORE SPACE
4114	NO.5 DECK FORWARD ACCOMMODATION SPACE
4121	NO.5 DECK MIDSHIP FWD ACCOMMODATION SPACE
4138	NO.5 DECK MIDSHIP ACCOMMODATION SPACE
4145	NO.5 DECK MIDSHIP AFT SPACE
4152	NO.5 DECK AFT ACCOMMODATION SPACE
	TUNNEL NO.39 STARBOARD L.O. TANK
5212	TEST

ITEMS OUTSTANDING TO COMPLETE 'AS'

3.3

Hull Survey

Watertight doors in W.T. bulkheads

Electric/Hydraulic operation and door indication lights on bridge inoperable due to damaged by fire on "D" Deck. Door numbers 15,16 and 23 only operated by hand pump remote and local. Doors 15,16,21,22 and 23 indication not working but door will close electrically.

(contd ... 5)

**INTERIM CERTIFICATE
PROVISIONAL ISSUE**

Ship's Name: NIEUW AMSTERDAM
LR/IMO Number: 8024014

Certificate Number: VCR 000155

STATUTORY DETAILS

ITEMS OUTSTANDING TO COMPLETE 'PLI'

Z Items Outstanding
Electrical/Hydraulic operation and door indication lights on bridge inoperable due to fire on "D" Deck. Door numbers 15,16 and 23 only operating by hand pump locally and remote. Door number 15, 16, 21, 22 and 23 indication not working but doors will close electrically from the bridge.

ITEMS OUTSTANDING TO COMPLETE 'PASS'

C2 Watertight Integrity
 Propeller & shaft seals
Starboard Propeller blades damaged by folding over of blade tips, causing cavitation fine cracking and loss of small section of blade tip. Tips to be straightened and polished.

F1 Watertight Doors
 Closure of doors from bridge etc.
Due to a Fire on "D" Deck between frames 91 and 127.5 Water Tight Doors 15,16 and 23 only operate by local and remote hand pump and WTD 15, 16, 21, 22 and 23 have no indication on bridge panel. Fire patrol posted on D Deck until electricians are restored. WTD #1 has excessive clearance between frame and door (approx 3mm).

L1 Cross Levelling, Dumping Arrangements
 Swimming Pool emptied & time checked
Pool dump time over 1.5 hrs. Piping system to be investigated for blockage.

(contd ... 6)

**INTERIM CERTIFICATE
PROVISIONAL ISSUE**

Ship's Name: NIEUW AMSTERDAM
LR/IMO Number: 8024014

Certificate Number: VCR 000155

STATUTORY DETAILS (contd.)

ITEMS OUTSTANDING TO COMPLETE 'PASS' (contd.)

- T6 Fixed Fire Extinguishing & Protection Systems
Location & system type - galley exhaust ducts
Galley Wet Chemical Fire Suppression System overdue for annual inspection and testing and location of instructions to be readily identifiable.
- CC1 Fire Insulation
Fire insulation in good condition & in accordance with approved plan
Fire on vessel in "D" Deck between frames 91 and 127.5. Fire insulation to be inspected and replaced as per SOLAS and Class requirement.
- DD1 Draft Stops, Smoke Holes, etc.
Draft stops behind linings
Fire on vessel in "D" Deck between frames 91 and 127.5. Draft stops to be inspected and replaced as per SOLAS and Class requirement.
- GG2 Electrical Detection System
Automatic sounding of audible alarm
Two (2) minute bridge unacknowledged fire detection alarm not operational.

(contd ... 7)

**INTERIM CERTIFICATE
PROVISIONAL ISSUE**

Ship's Name: NIEUW AMSTERDAM

LR/IMO Number: 8024014

Certificate Number: VCR 000155

STATUTORY DETAILS (contd.)

ITEMS OUTSTANDING TO COMPLETE 'PASS' (contd.)

TT1

Emergency Lights

Testing

Low Location Lighting emergency battery packs out of date, approx 50 packs to renew.

*** END ***